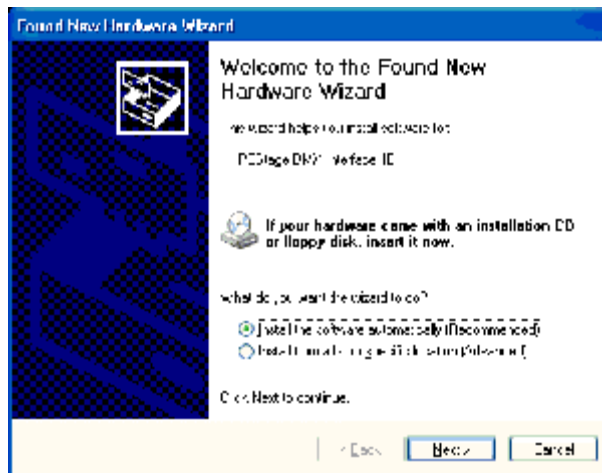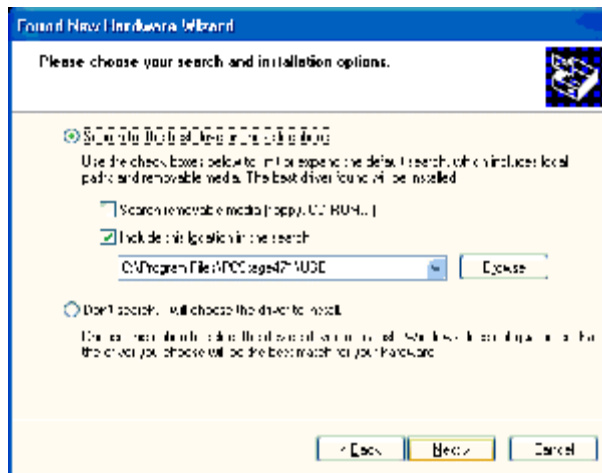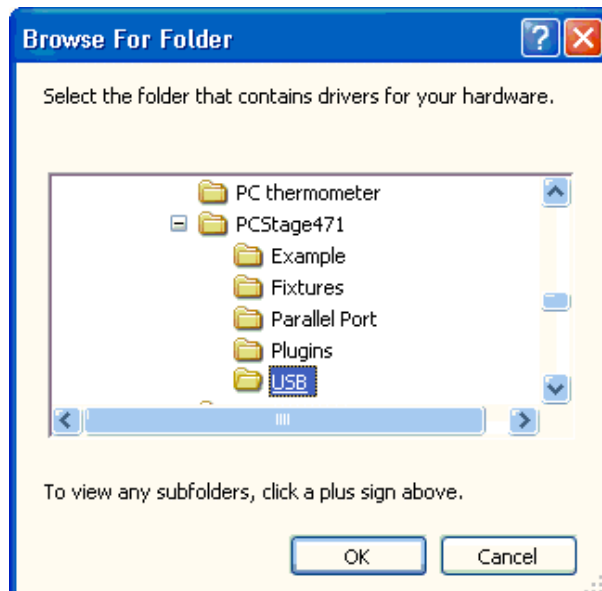# Loading the PCStage USB Full driver.

1. Plug the PCStage interface. The computer should recognise that the interface has been connected and prompt you for a 'driver':
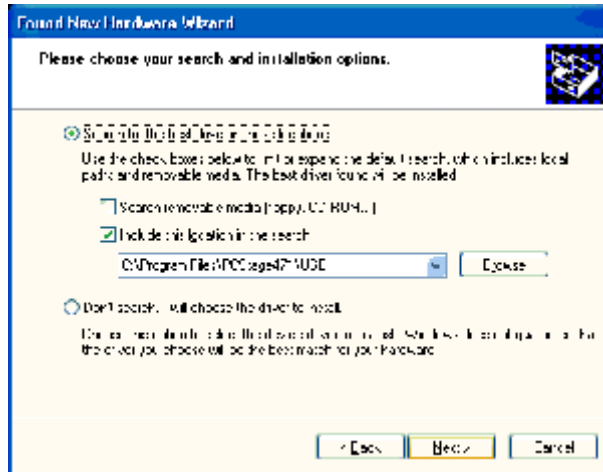


2. Select the "Install from a list or specific location (Advanced)" and click <next>.  This screen will appear:
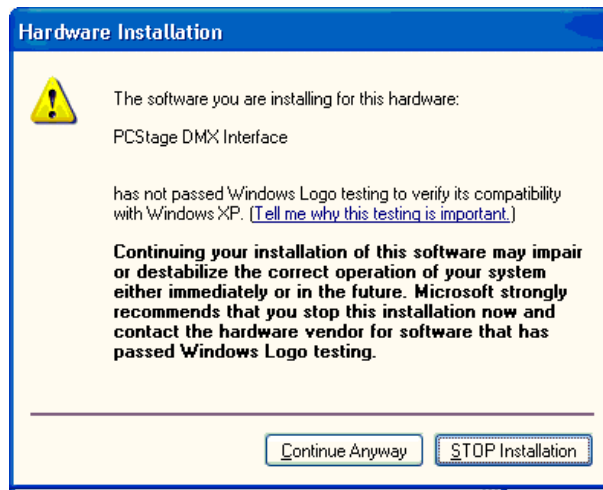


3. Tick the "Include this location in the search" box and then <Browse> your computer to end up in location you installed the PCStage program.  When you have selected the USB directory, <OK>.
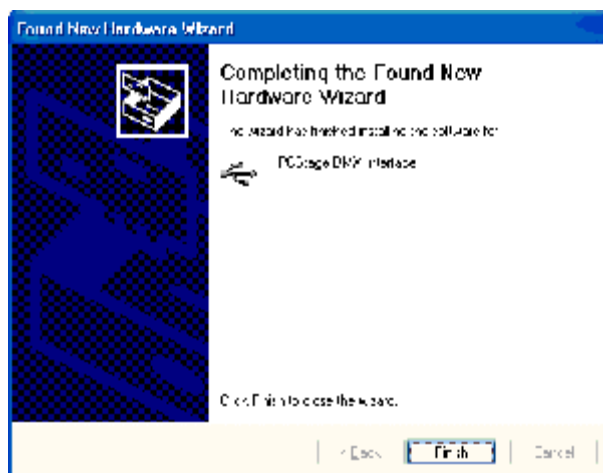
4. *This will close the 'browse for folder' window and return you to the previous 'found new hardware':*
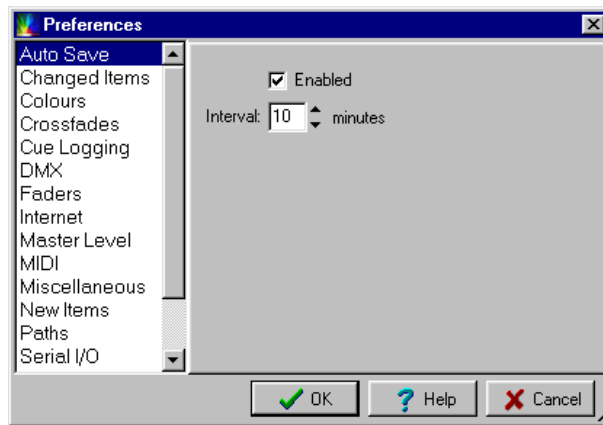


5. *Click <Next>.*



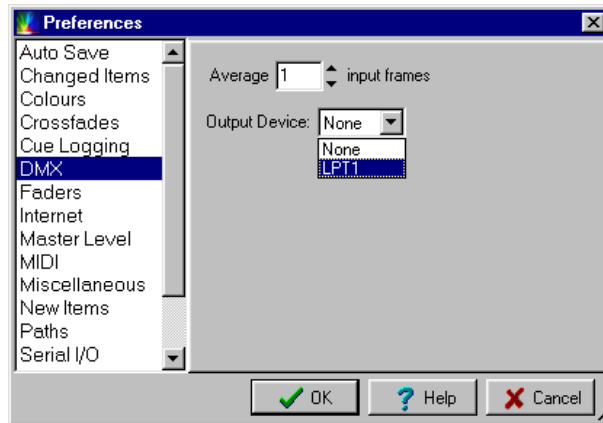6. *Click <Continue Anyway>*



*And that's done.*

7. *Now, start PCStage (or restart it if already running) and select <PCStage> from the menu bar and then <Preferences>:*

8. *Select <DMX> and then <USB> from the drop down list:*



9. *Click <OK> and you're done.*

10. *The Green DMX out light on your interface should be lit as confirmation all is OK.*